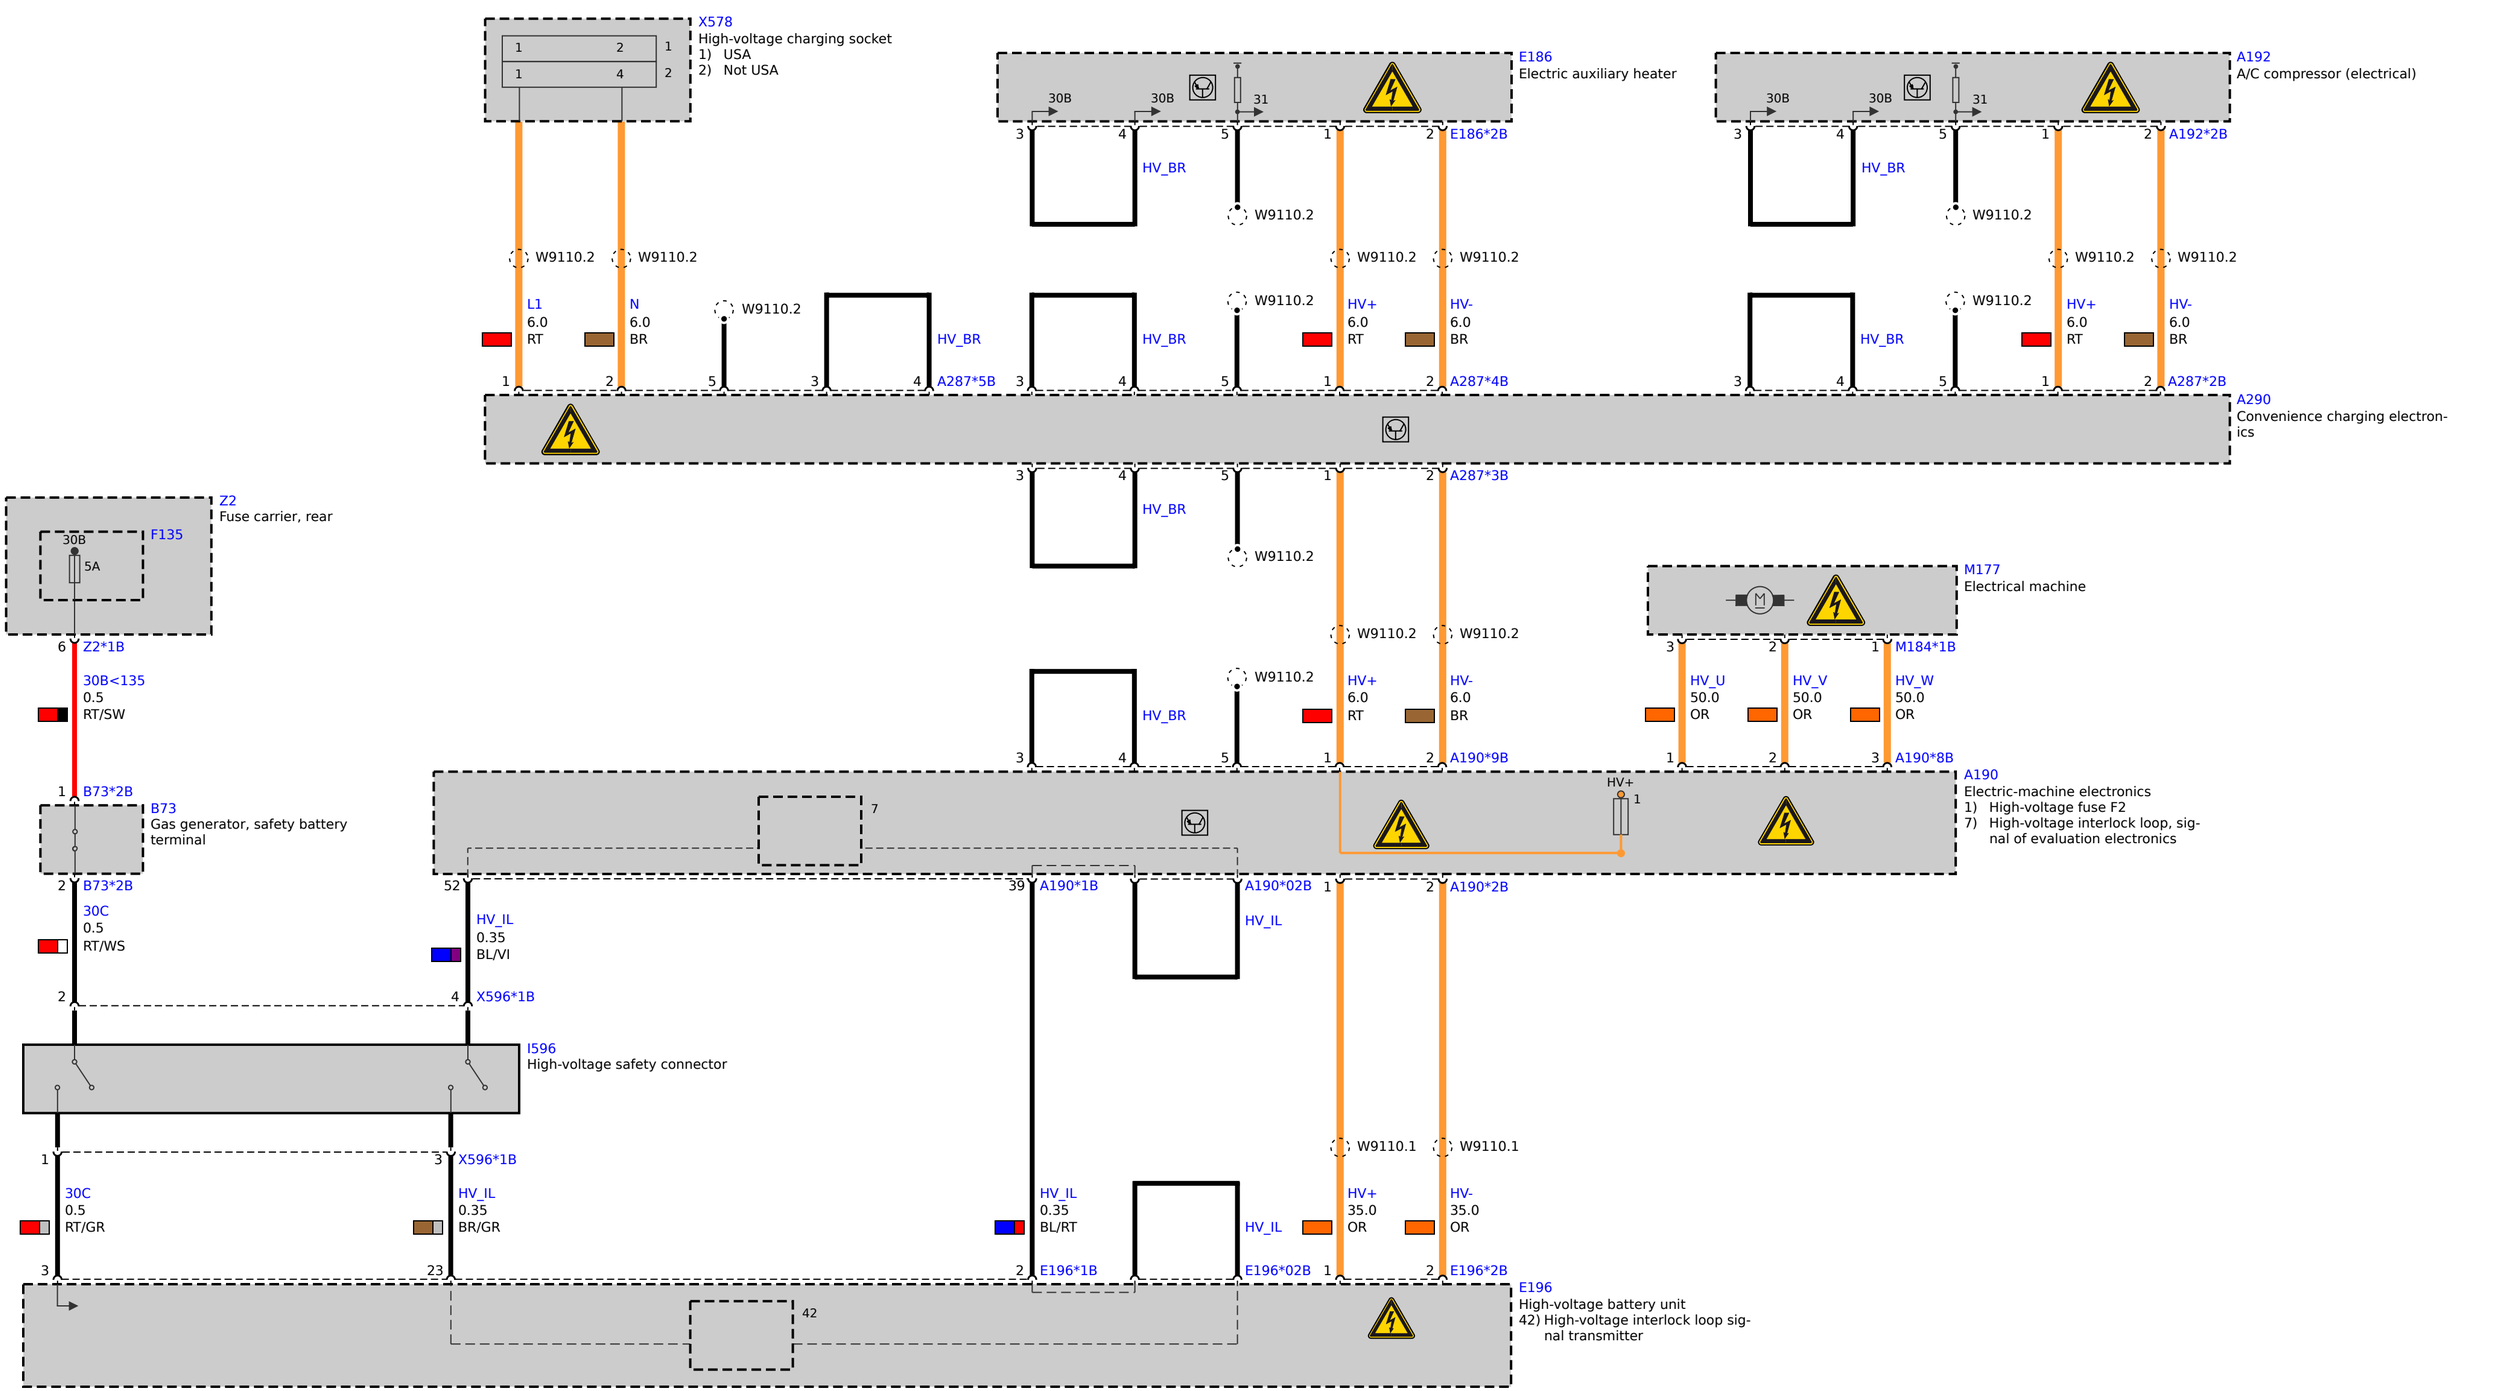
X578
High-voltage charging socket
1) USA
2) Not USA
E186
Electric auxiliary heater
A192
A/C compressor (electrical)
A290
Convenience charging electron-ics
M177
Electrical machine
A190
Electric-machine electronics
1) High-voltage fuse F2
7) High-voltage interlock loop, sig-nal of evaluation electronics
Z2
Fuse carrier, rear
F135
B73
Gas generator, safety battery terminal
I596
High-voltage safety connector
E196
High-voltage battery unit
42) High-voltage interlock loop sig-nal transmitter
L1 6.0 RT
N 6.0 BR
HV_BR
HV+ 6.0 RT
HV- 6.0 BR
HV_U 50.0 OR
HV_V 50.0 OR
HV_W 50.0 OR
30B<135 0.5 RT/SW
30C 0.5 RT/WS
30C 0.5 RT/GR
HV_IL 0.35 BL/VI
HV_IL 0.35 BR/GR
HV_IL 0.35 BL/RT
HV+ 35.0 OR
HV- 35.0 OR
W9110.2
W9110.1
X596*1B
A287*5B
A287*4B
A287*3B
A287*2B
A190*9B
A190*8B
A190*1B
A190*02B
A190*2B
E186*2B
A192*2B
E196*1B
E196*02B
E196*2B
B73*2B
Z2*1B