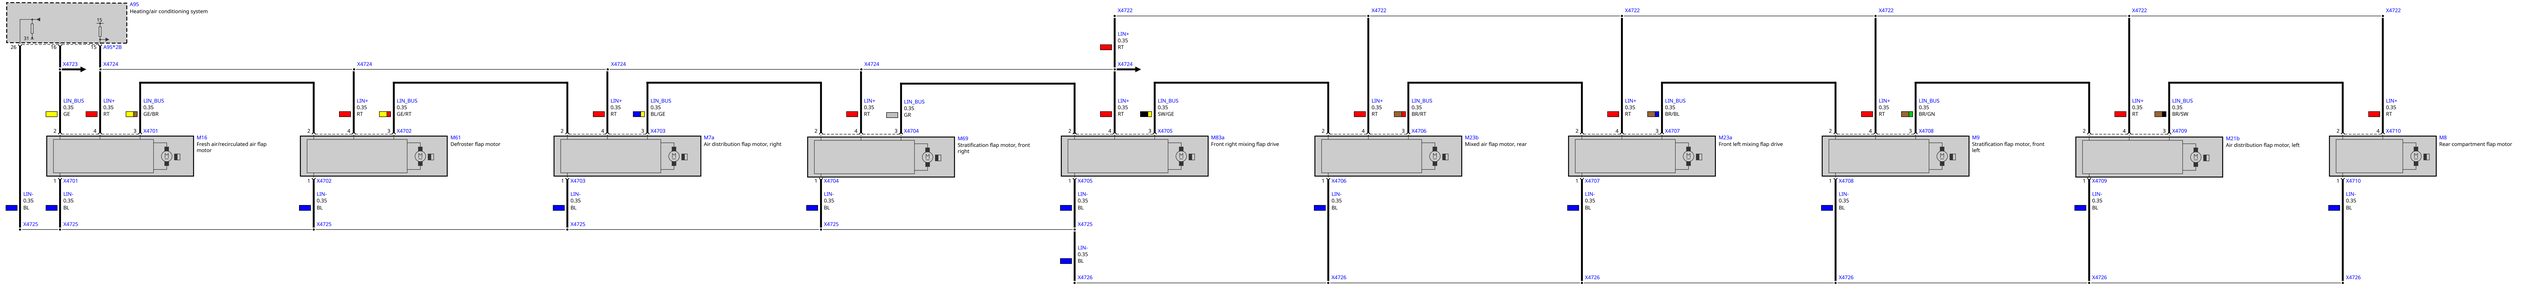
A95
Heating/air conditioning system
30
58
15
A95*2B
X4723
X4724
LIN_BUS
0.35
GE
LIN+
0.35
RT
LIN_BUS
0.35
GE/BR
2
4
3
X4701
M16
Fresh air/recirculated air flap motor
1
X4701
LIN-
0.35
BL
LIN-
0.35
BL
X4725
X4724
LIN+
0.35
RT
LIN_BUS
0.35
GE/RT
X4702
M61
Defroster flap motor
X4702
X4725
X4724
LIN+
0.35
RT
LIN_BUS
0.35
BL/GE
X4703
M7a
Air distribution flap motor, right
X4703
X4725
X4724
LIN+
0.35
RT
LIN_BUS
0.35
GR
X4704
M69
Stratification flap motor, front right
X4704
X4725
X4722
LIN+
0.35
RT
X4724
LIN+
0.35
RT
LIN_BUS
0.35
SW/GE
X4705
M83a
Front right mixing flap drive
X4705
X4725
X4726
X4722
LIN+
0.35
RT
LIN_BUS
0.35
BR/RT
X4706
M23b
Mixed air flap motor, rear
X4706
X4726
X4722
LIN+
0.35
RT
LIN_BUS
0.35
BR/BL
X4707
M23a
Front left mixing flap drive
X4707
X4726
X4722
LIN+
0.35
RT
LIN_BUS
0.35
BR/GN
X4708
M9
Stratification flap motor, front left
X4708
X4726
X4722
LIN+
0.35
RT
LIN_BUS
0.35
BR/SW
X4709
M21b
Air distribution flap motor, left
X4709
X4726
X4722
LIN+
0.35
RT
X4710
M8
Rear compartment flap motor
X4710
X4726